

Temp Transformer Replacement in Slidedriver, StrongArm, HydraSupply

OPERATORS: HydraSupply™ (not XL), SlideDriver™, and StrongArm™


EFFECTIVE DATE: 04/06/2023

SUBJECT: Temporary replacement of transformer (P/N MX000486) with modified part (P/N MX5657-xxx).


DESCRIPTION: Standard transformer (P/N MX000486) will be temporarily unavailable, so a new transformer is sourced to provide identical form, fit, and function, with additional modifications to the wiring so colors match the documentation in the field.

IMPACT: Minimal customer impact, Original wires will either be heat shrunk or extended (based on operator) with current documented wire colors.

MX5657-02 is the *modified* replacement transformer for MX000486 in HydraSupply, StrongArm, and SlideDriver (excluding X2/X3 models). Diagram at right shows modified wire colors. The wires are colored with heat shrink to match current units.

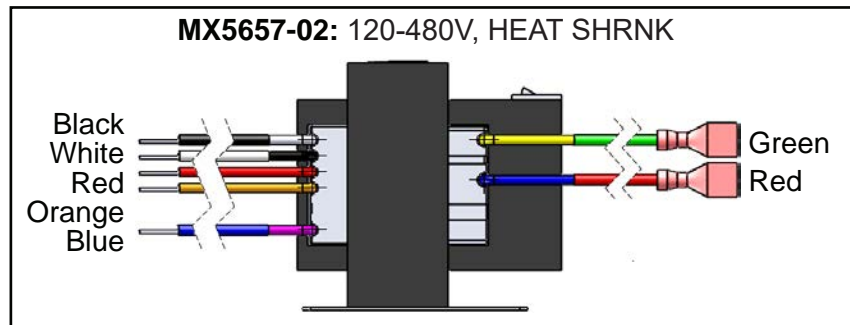

MX5657-03 is the *modified* replacement transformer for MX000486 in SlideDrivers with VFDs (X2/X3 Models). Diagram at right shows modified wire colors. The wires have been cut and spliced to make them the proper length and color.

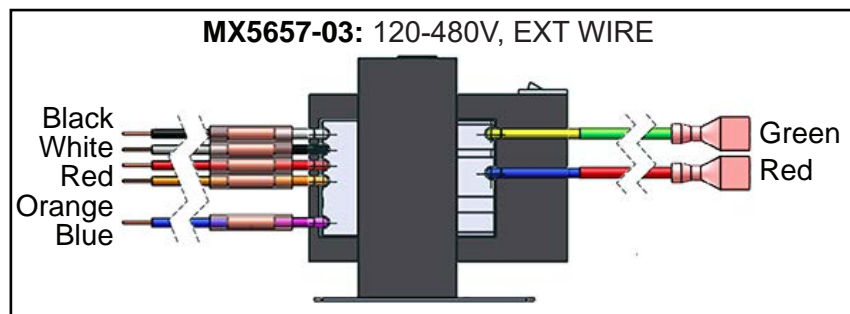

Contact Information: Visit <https://support.hysecurity.com/hc/en-us> for installation manuals, replacement part instructions, part diagrams and more. For the name of a qualified distributor near you, call HySecurity at 800-321-9947. *Before contacting your distributor or HySecurity Technical Support, obtain the serial number of your operator.