

StrongArm M30/M50 Enclosure Door Weather Stripping

OPERATORS: M30/M50 StrongArm Crash

DATE: 04/20/2022

SUBJECT: Weather Stripping for Enclosure Doors (ECO 10571)

ISSUE DESCRIPTION: In colder climates, snow has been found to be blown into the enclosures.

RESOLUTION: New units will have the section of weather stripping added in production. Current units in colder climates may have two strips (per Kit P/N MX5430) sent to the end-user on request to install onto the enclosure doors.

FIELD INSTRUCTIONS:

For applicable units in the field, two pieces of weather stripping are supplied (one per each of two doors) and is installed onto each door as follows:

1. Unlock and remove door (1 of 2) from enclosure (Fig-1).
2. Push rubber weather stripping section over the bottom edge of door (Fig-1), ensuring that the side with the inner tab facing toward the interior (see **DETAIL: End Profile** for reference).
3. Replace door and lock.
4. Repeat Steps 1-3 on other door (2 of 2).

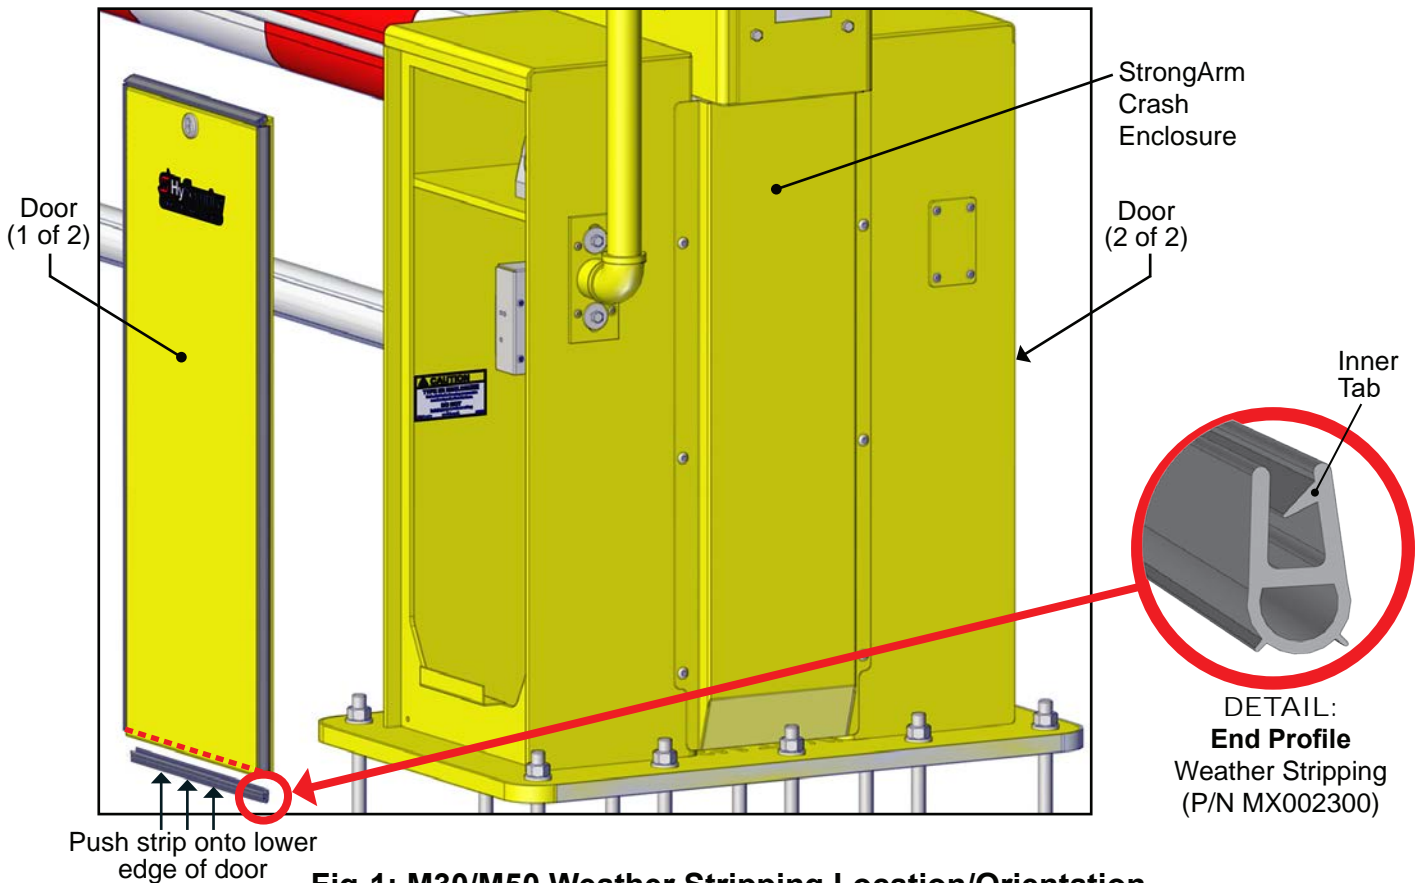


Fig-1: M30/M50 Weather Stripping Location/Orientation

Contact Information: Visit <https://support.hysecurity.com/hc/en-us> for installation manuals, replacement part instructions, part diagrams and more. Qualified HySecurity distributors are experienced and trained to assist in resolving installation problems. For the name of a qualified distributor near you, call HySecurity at 800-321-9947. *Before contacting your distributor or HySecurity Technical Support, obtain the serial number of your operator.